
AutoCAD[°] 2020 Tutorial Second Level 3D Modeling



Randy H. Shih

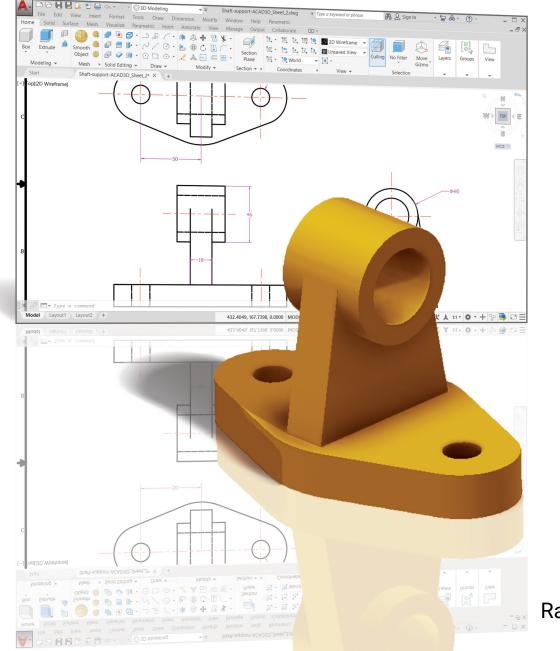


Better Textbooks. Lower Prices. www.SDCpublications.com

Visit the following websites to learn more about this book:



Chapter 3 3D Wireframe Modeling

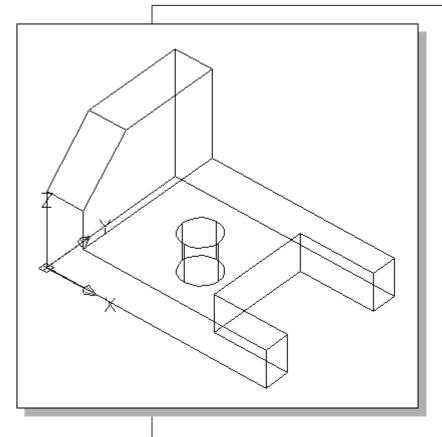




Learning Objectives

- Use the Setup Wizard
- Create Wireframe Models
- Apply the Box Method in Creating Models
- Construct with the Copy Command
- Understand the Available 3D Coordinates Input Options
- Use the View Toolbar
- Set up and Use the Trim options

Introduction

The first true 3D computer model created on CAD systems in the late 1970s was the 3D wireframe model. Computer generated 3D wireframe models contain information about the locations of all the corners and edges in space coordinates. The 3D wireframe models can be viewed from any direction as needed and are in general reasonably good representations of 3D design. But because surface definition is not part of a wireframe model, all wireframe images have the inherent problem of ambiguity. For example, in the figure displayed below, which corner is in front, corner A or corner B? The ambiguity problem becomes much more serious with complex designs that have many edges and corners.

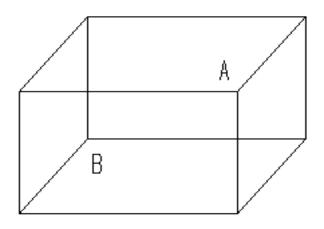


Wireframe Ambiguity: Which corner is in front, A or B?

The main advantage of using a 3D wireframe modeler to create 3D models is its simplicity. The computer hardware requirements for wireframe modelers are typically much lower than the requirements for surface and solid modelers. A 3D wireframe model, also known as a stick-figure model or a skeleton model, contains only information about the locations of all the corners and edges of the design in space coordinates. You should also realize that, in some cases, it could be quite difficult to locate some of the corner locations while creating a 3D wireframe model. Note that 3D wireframe modelers are usually used in conjunction with surfacing modelers, which we will discuss in the later chapters of this text, to eliminate the problem of ambiguity.

With most CAD systems, creating 3D wireframe models usually starts with constructing 2D entities in 3D space. Two of the most commonly used methods for creating 3D wireframe models are the **Box method** and the **2D Extrusion method**. As the name implies, the *Box method* involves the creation of a 3D box with the edges constructed from the overall height, width and depth dimensions of the design. The 3D wireframe model is typically completed by locating and connecting corners within the box.

The 2D Extrusion method involves making copies of 2D geometries in specific directions. This method is similar to the 2½D extrusion approach illustrated in the previous chapter (Chapter 2) with several differences. First of all, we do not really extrude the wireframe entities; instead we simply make copies of wireframe entities in the desired directions. Secondly, constructed wireframe entities have true 3D space coordinates, while the *thickness* approach creates entities with no true 3D coordinates. Finally, no surfaces are created in the 3D wireframe models.


In this chapter, we will illustrate the general procedure to construct a 3D wireframe model using both the box method and the 2D extrusion method. To illustrate the AutoCAD 3D construction environment, we will create the wireframe model using only the default UCS system, which is aligned to the world coordinate system. Repositioning and/or reorienting the User Coordinate System can be useful in creating 3D models. However, it is also feasible to create 3D models referencing only a single coordinate system. One important note about creating wireframe models is that the construction techniques mostly concentrate on locating the space coordinates of the individual corners of the design. The ability to visualize designs in the form of 3D wireframe models is extremely helpful to designers and CAD operators. It is hoped that the experience of thinking and working on 3D wireframe models, as outlined in this chapter, will enhance one's 3D visualization ability.

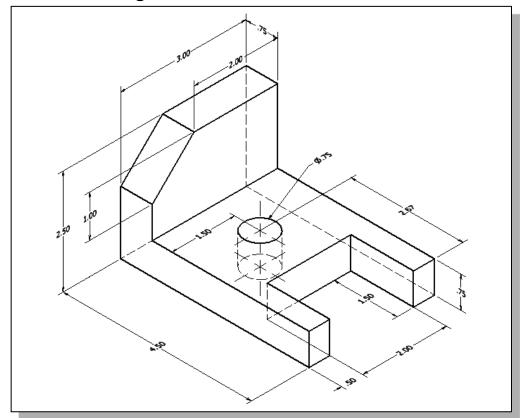

The Locator Design

Starting Up AutoCAD 2020

1. Start AutoCAD 2020 by selecting the *Autodesk* folder in the **Start** menu as shown. Once the program is loaded into the memory, click Start Drawing to start a new drawing.

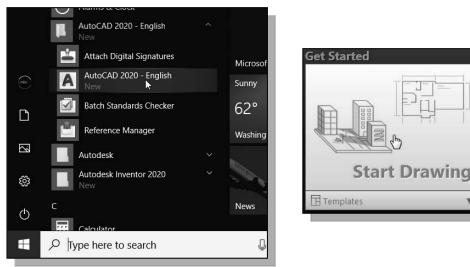


Activate the Startup Option


In AutoCAD 2020, we can use the Startup dialog box to establish different types of drawing settings. The Startup dialog box can be activated through the use of the **STARTUP** system variable.

The STARTUP system variable can be set to 0, 1, 2 or 3:

- 1: displays the *Create New Drawing* dialog box. •
- 0: displays the *Select Template* dialog box (default). •
- 2: Displays the *Start Tab* with options; a custom dialog box can be used. •
- 3: Displays the *Start Tab* with the ribbon pre-loaded (default).

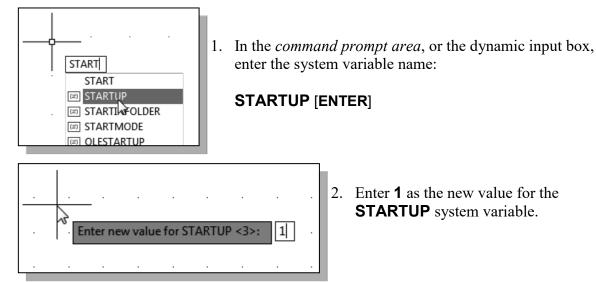


2. Enter **1** as the new value for the **STARTUP** system variable.

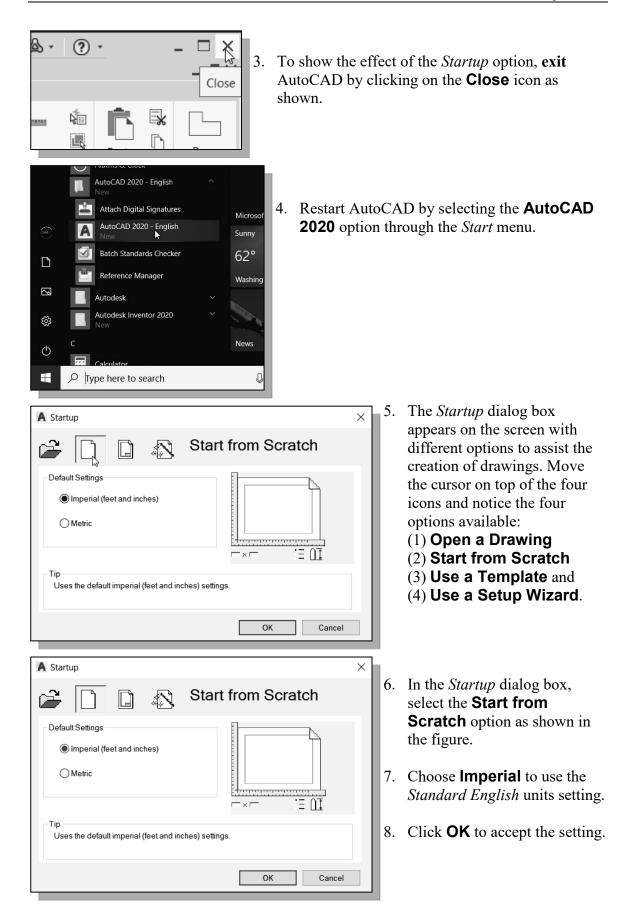


Create the Rectangular Base of the Design

We will first construct the wireframe geometry defining the rectangular base of the design.

1. In the *Status Bar* area, reset the options and turn **ON** the *Grid Display, Polar Tracking, Object Snap, Object Snap Tracking, Dynamic Input* and *Lineweight* options.

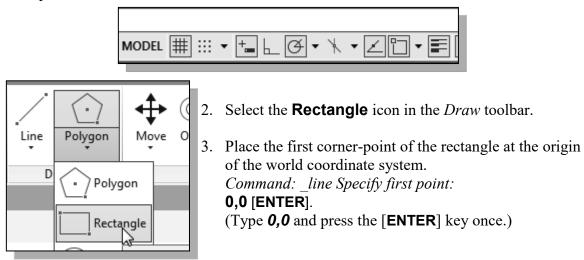


 We will create a 4.5" × 3.0" rectangle by entering the absolute coordinates of the second corner. Specify other corner point or [Dimension]: 4.5,3 [ENTER].

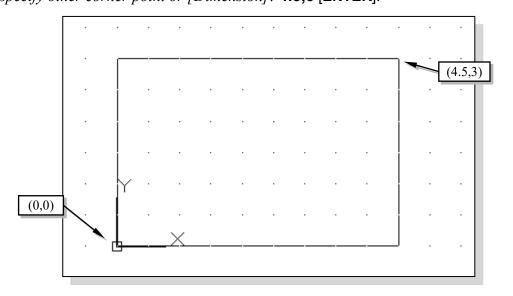

• The Rectangle command creates rectangles as *polyline* features, which means the four segments of a rectangle are created as a single object. In AutoCAD, rectangles are wireframe entities.

5. In the *Menu Bar*, select: [View] → [3D Views] → [SE Isometric]


	£	Named Views			
		3D Views	Þ	Viewpoint Presets	
	۳,	Create Camera	ŤΩ	Viewpoint	
		Show Annotative Objects		Plan View 🕨	
	•	Hide	ø	Тор	
		Visual Styles	Ø	Bottom	
		Render	ø	Left	
		Motion Path Animations	Ð	Right	
			P	Front	
	-	Display	Ø	Back	
		Toolbars		SW Isometric	
			۲	SE Isometric	
			٩	NE Isometric	
ng	/Pro	ject/Edge/eRase/Undo]:	\$	NW Isometric	

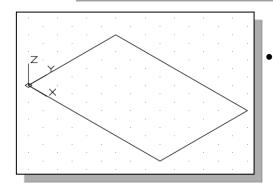

Notice the orientation of the sketched 2D rectangle in relation to the displayed AutoCAD user coordinate system. By default, the 2D sketch-plane is aligned to the XY plane of the world coordinate system.


Create a 3D Box

We will create a 3D box to define the 3D boundary of the design. We will do so by placing a copy of the base rectangle at the corresponding height elevation of the design. The dimensions of the 3D box are therefore based on the height, width and depth dimensions of the design.

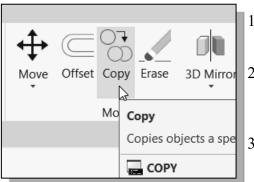


- 1. Click on the **Copy Object** icon in the *Modify* toolbar.
- 2. In the command prompt area, the message *"Select objects:"* is displayed. Pick any edge of the sketched rectangle.
- 3. Inside the graphics window, right-click once to accept the selection.


- 4. In the command prompt area, the message "Specify base point or displacement, or [Multiple]:" is displayed. Pick any corner of the sketched rectangle as a base point to create the copy.
- 5. In the command prompt area, the message "Specify second point of displacement or <use first point as displacement>:" is displayed. Enter @0,0,2.5 [ENTER]. (The three values are the X, Y and Z coordinates of the new location.)

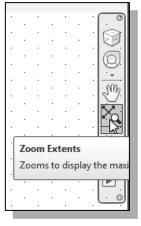

6. Select the **[Zoom Extents]** option in the *View* pull-down menu to view the constructed geometry.

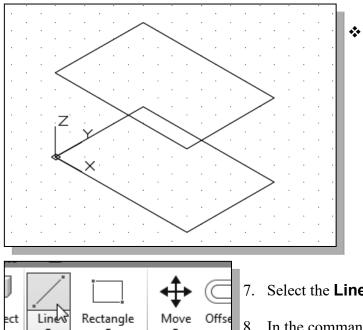


The two rectangles represent the top and bottom of a 3D box defining the 3D boundary of the design. Note that the construction of the second rectangle was independent of the UCS, User Coordinate System; the UCS is still aligned to the world coordinate system.

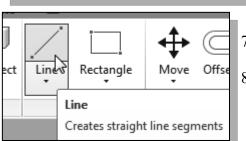

- 7. Select the **Line** icon in the *Draw* toolbar.
- 8. In the command prompt area, the message " *line* Specify first point:" is displayed. *Command: line Specify first point:* 0,0 [ENTER]
- 9. In the command prompt area, the message "Specify next point or [Undo]." is displayed.

Command: line Specify first point: **0,0,2.5** [ENTER].

 Notice the Line command correctly identified the entered 3D coordinates of the second point. The default Z-coordinate, which is set by the AutoCAD UCS, is applied automatically whenever the Z-coordinates are omitted.

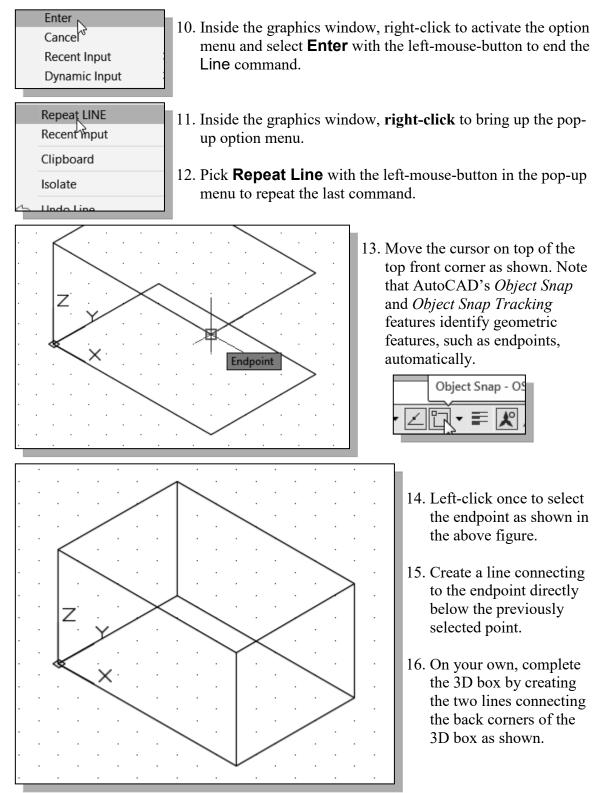


Object Snap Toolbar

1. In the *Menu Bar* select **[Tools]** \rightarrow **[Toolbars]** \rightarrow **[AutoCAD]**.


Тос	ols	Draw	Dimension	Modify	Windov	v He	elp Pa	arame
	Wo	rkspaces			>			
	Palettes				>	.↑.	Ē	\bigcirc
	Toolbars				>	Auto	CAL	>
>	Command Line		Ct	trl+9 Move O trl+0		Offset	Сор	
	Clean Screen					Ct		
								Mod

AutoCAD provides many toolbars for access to frequently used commands, settings, and modes. The *Standard*, *Object Properties*, *Draw*, and *Modify* toolbars are displayed by default. The *check marks* in the list identify the toolbars that are currently displayed on the screen.

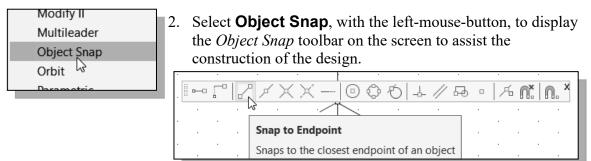


Object Snap is an extremely powerful construction tool available on most CAD systems. During an entity's creation operations, we can snap the cursor to points on objects such as endpoints, midpoints, centers, and intersections. For example, we can turn on Object Snap and quickly draw a line to the center of a circle, the midpoint of a line segment, or the intersection of two lines.

Use the Snap Options to Locate the Top Corners

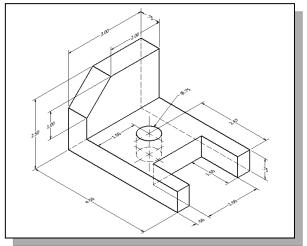



We will use the *Object Snap* options to identify the locations of the top corners of the model.

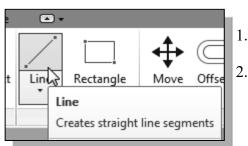

1. Select the **Line** icon in the *Draw* toolbar.


 In the command prompt area, the message "_line Specify first point:" is displayed. Select Snap From in the Object Snap toolbar.



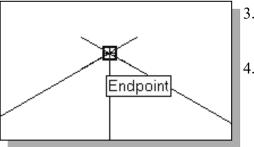


- 3. Select the **top back corner** as the reference point as shown.
- 4. In the command prompt area, the message *"_line Specify first point: from Base point:<Offset>:"* is displayed.
 - *Command:* **@0.75,0,0** [ENTER].
- By using the relative coordinate input method, we can locate the position of any point in 3D space. Note that the entered coordinates are measured relative to the current UCS.
- 5. In the command prompt area, the message "Specify next point or [Undo]." is displayed.


Command: Specify next point or [Undo]: @0,-2,0 [ENTER].

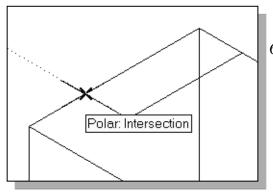

6. Move the cursor toward the left to create a perpendicular line. Select a location that is on the back line as shown; notice the displayed *Object Snap/Tracking* tips: Polar: Intersection.




7. In the command prompt area, the message "Specify next point or [Undo]:" is displayed. Select **Snap From** in the Object Snap toolbar.

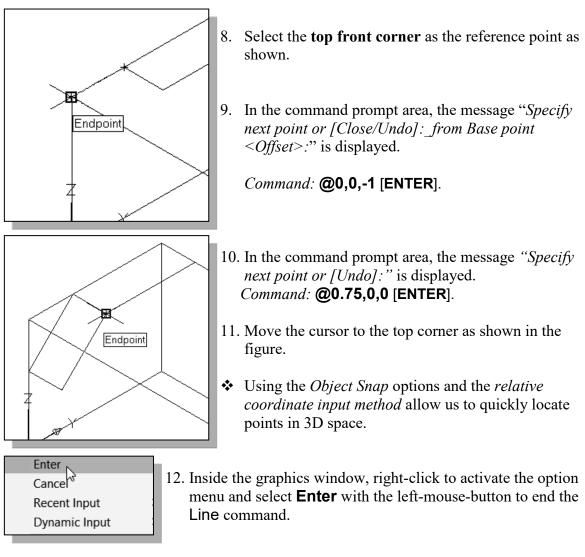


Use the Copy Option to Create Additional Edges

The Copy option can also be used to create additional edges of the wireframe model.

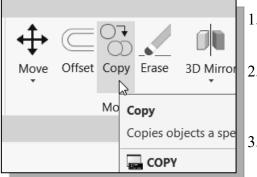

- 1. Click on the **Copy Object** icon in the *Modify* toolbar.
- 2. In the command prompt area, the message *"Select objects:"* is displayed. Pick **any edge** of the bottom rectangle.
- 3. Inside the graphics window, **right-click** once to accept the selection.
- 4. In the *command prompt area*, the message "*Specify base point or displacement, or* [*Multiple*]:" is displayed. Pick **any corner** of the base rectangle to be used as a base point to create the copy.


5. In the command prompt area, the message "Specify second point of displacement or <use first point as displacement>:" is displayed. Enter @0,0,0.75 [ENTER].

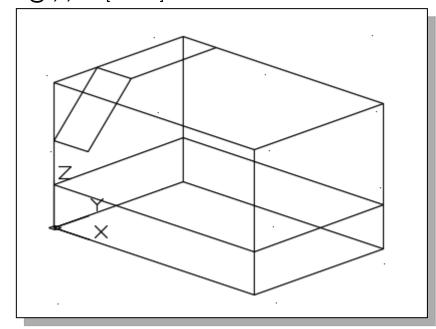

Repeat COPY
Recent Input
Clipboard
Isolate


6. Inside the graphics window, right-click to bring up the popup option menu.


7. Pick **Repeat Copy Object** with the left-mouse-button in the pop-up menu to repeat the last command.

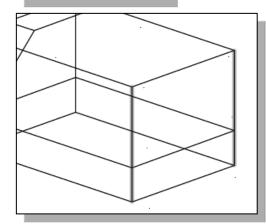

- 8. Pick the two **vertical lines** on the right side of the 3D box as shown.
- 9. Inside the graphics window, **right-click** once to accept the selection.


10. In the command prompt area, the message "Specify base point or displacement, or [Multiple]:" is displayed. Pick the **top back corner** of the wireframe as a base point to create the copy.

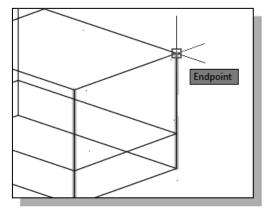

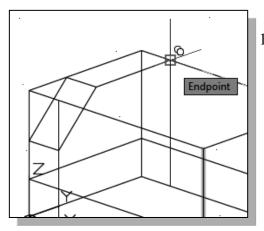


The copy option is an effective way to create additional edges of wireframe models, especially when multiple objects are involved. With wireframe models, the emphasis is placed on the corners and edges of the model.

11. In the command prompt area, the message "Specify second point of displacement or <use first point as displacement>:" is displayed. Pick the top back corner of the wireframe model as shown.

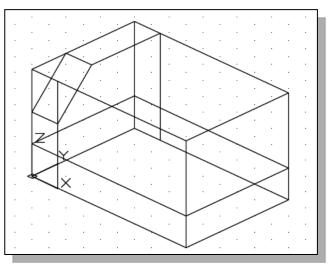


Use the Trim Command


The Trim command can be used to shorten objects so that they end precisely at selected boundaries.

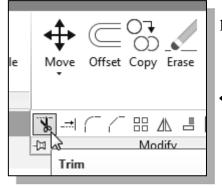


- 1. Select the **Trim** command icon in the *Modify* toolbar. In the command prompt area, the message "*Select boundary edges... Select objects:*" is displayed.
- First, we will select the objects that define the boundary edges to which we want to trim the object.

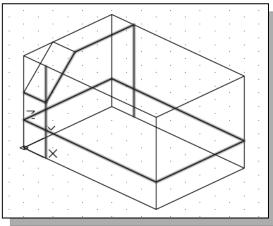


- 2. Pick the highlighted edges as shown in the figure; these edges are the *boundary edges*.
- 3. Inside the graphics window, **right-click** once to accept the selection of boundary edges and proceeds with the Trim command.

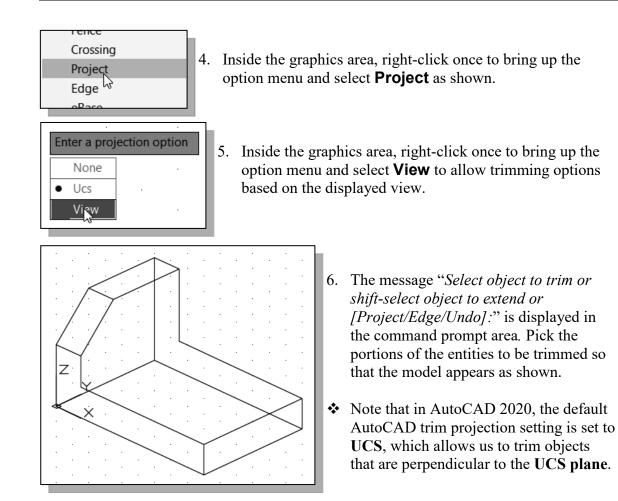



7. Inside the graphics window, right-click to bring up the option menu and select **Enter** to end the Trim command.


8. On your own, use the **Line** command to complete the inside corner of the wireframe model as shown.

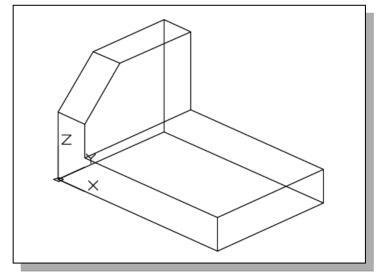


Use the View Toolbar

Tools	Draw Dimension	Modify Window	Help Param				
	orkspaces lettes	>	↑.				
Тос	olbars	>	AutoCAL >	1			
Co	mmand Line	Ctrl+9	Nove Offset Cop	2			
Cle	ean Screen	Ctrl+0	*				
		1	May	4			
UCS UCS II View Viewports Visual Styles Walk and Fly	View toolba➢ The View to	w , with the left-mo ar on the screen. oolbar contains tw ly switch to standa	vo sections of ic	ons that allow			
2D Views 3D Views							
Dynamic Rotation – Free Orbit							

1. In the *Menu Bar* select [Tools] \rightarrow [Toolbars] \rightarrow [AutoCAD].




* The Free Orbit view displays an *arcball*, which enables us to manipulate the view of 3D objects by clicking and dragging with the left-mouse-button.

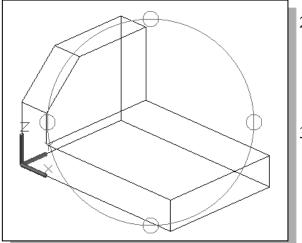


- 2. Inside the arcball, press down the leftmouse-button and drag it up and down to rotate about the screen X-axis. Dragging the mouse left and right will rotate about the screen Y-axis.
- 3. Move the cursor to different locations on the screen, outside the *arcball* or on one of the four small circles, and experiment with the real-time dynamic rotation feature of the Free Orbit command.

Use the Offset Command to Create Parallel Edges


The AutoCAD Offset option can also be used to create edges that are at specific distances to existing 3D wireframe edges. Prior to creating the parallel edges, we will first convert one of the polylines to individual line segments.

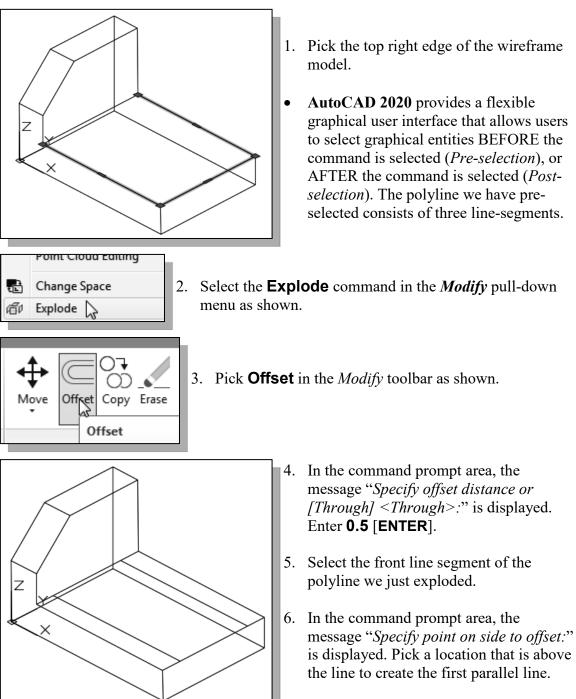


7. Select the back line segment of the polyline we exploded and create another parallel line as shown.

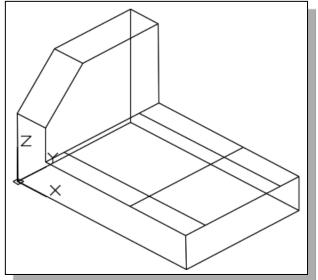

- On your own, repeat the above steps and create another parallel line (distance: 1.5) as shown.
- In creating parallel edges, the Offset command can be viewed as an alternative to the Copy command. In 3D wireframe modeling, the focus is on identifying the edges and corners of the model. Most of the 2D construction tools are also applicable in a 3D environment.

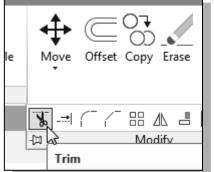


- 9. Select the **Trim** command icon in the *Modify* toolbar.
- 10. In the command prompt area, the message "Select boundary edges... Select objects:" is displayed. Pick the highlighted edges as shown in the figure; these edges are the boundary edges.

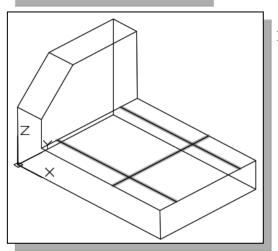

12. On your own, trim the line segments so that the wireframe model appears as shown.


11. Inside the graphics window, right-click to accept the selection of boundary edges and proceeds with the Trim command.

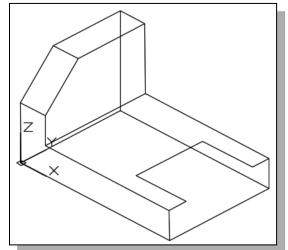


Create a Circle above the UCS Sketch Plane


÷ 1. Select the **Circle** command icon in the *Draw* toolbar. Line Rectangle Move By default, the XY plane of the UCS defines the sketching • Polygon plane for constructing 2D geometric entities. Rectangle Circle 2. In the command prompt area, the message " *circle* •----Specify center point for circle or[3P/2P/Ttr (tan tan radius)]:" is displayed. Select **Snap From** in the Object Snap From Snap toolbar. Locates a point offse 3. Select the **top right corner** as the reference point as shown. 4. In the command prompt area, the message "Specify next point or [Close/Undo]: from Base point *<Offset>:*" is displayed. Endpoint Command: @-2.67,1.5 [ENTER]. 5. In the command prompt area, the message "Specify radius of *circle or [Diameter]:*" is displayed. Command: 0.375 [ENTER]. Ζ The circle is created above the • sketching plane with the **Snap** From option.


Complete the Wireframe Model

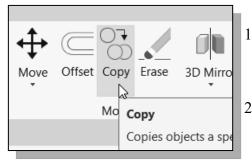


- 1. Click on the **Copy Object** icon in the *Modify* toolbar.
- 2. In the command prompt area, the message *"Select objects:"* is displayed. Pick the edges and the circle as shown in the figure.



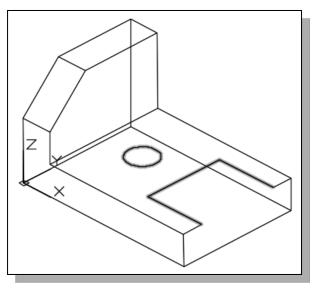


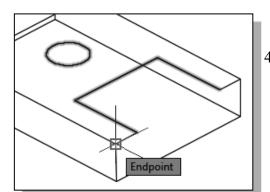


4. In the command prompt area, the message *"Specify base point or displacement, or [Multiple]:"* is displayed. Pick the front right corner as shown.

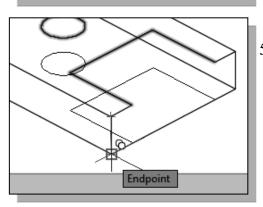



5. In the command prompt area, the message "Specify second point of displacement or <use first point as displacement>:" is displayed. Pick the bottom-right corner as shown.

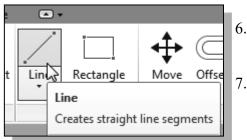




- 6. Select the **Line** icon in the *Draw* toolbar.
- 7. On your own, create the lines connecting the corners of the created edges as shown in the figure below.
- 8. Use the **Snap to Quadrant** option to create edges in between the two circles.

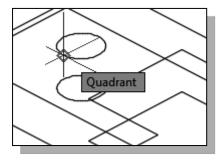


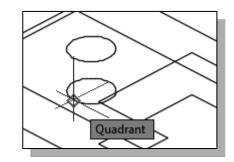

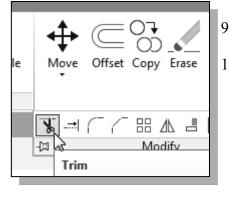

- 9. Select the **Trim** command icon in the *Modify* toolbar.
- 10. On your own, trim the center portion of the bottom right edge and complete the wireframe model as shown.

 On your own, save the Locator design (Locator.dwg); this model will be used again in the Surface Modeling chapter.

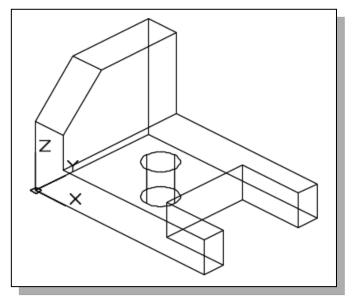

Review Questions:

- 1. Describe some of the control options available with the Free Orbit command.
- 2. List and describe two different methods to create 3D edges from existing 3D edges in AutoCAD 2020.
- 3. How many of the UCS options were used to create the 3D model in this chapter and how many were used to create the model in the previous chapter?
- 4. When and why would you use the Trim-Project-View option?
- 5. Identify the following commands:












Exercises: All dimensions are in inches.

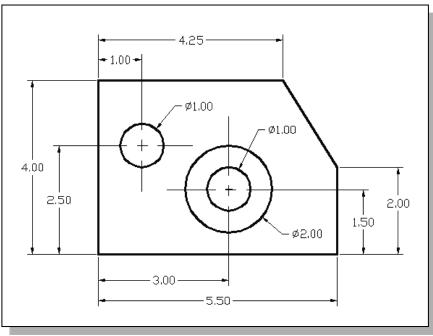


1. Thickness: Base **0.25** inches. Boss height **0.125** inches. The two diameter 1.00 holes are through holes.


2.

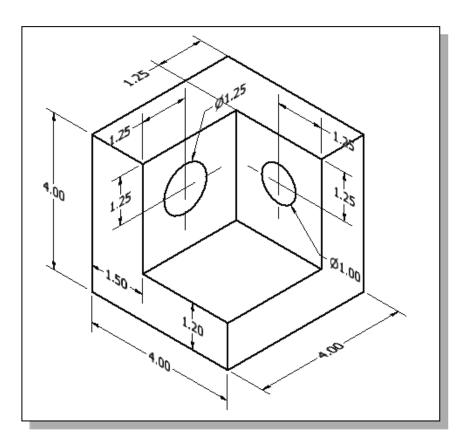

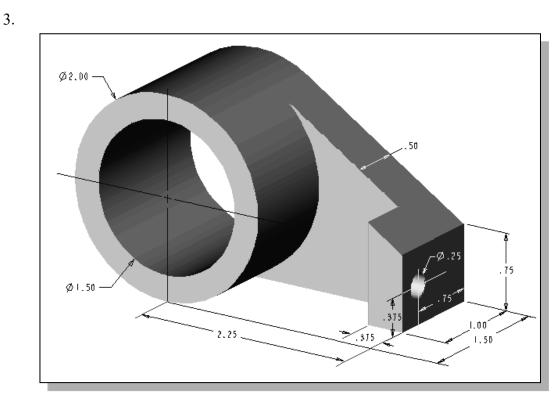

4.

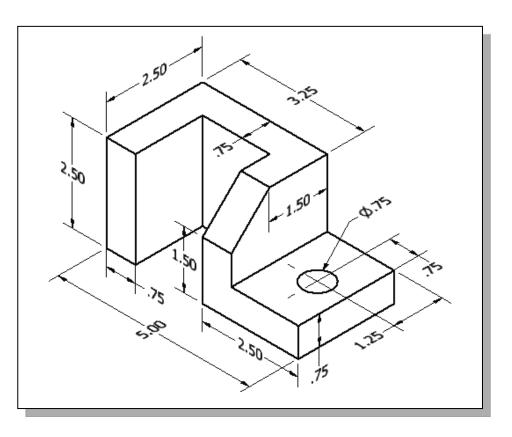

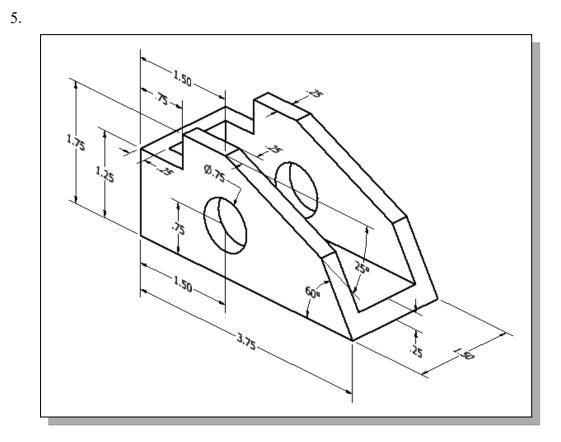

Notes: